



Arm® Neoverse™ N3 (MP195)

Software Developer Errata Notice

Date of issue: September 06, 2024


Non-Confidential

Document version: 5.0

Copyright © 2023-2024 Arm® Limited (or its affiliates). All rights reserved.

Document ID: SDEN-3050973

This document contains all known errata since the r0p0 release of the product.

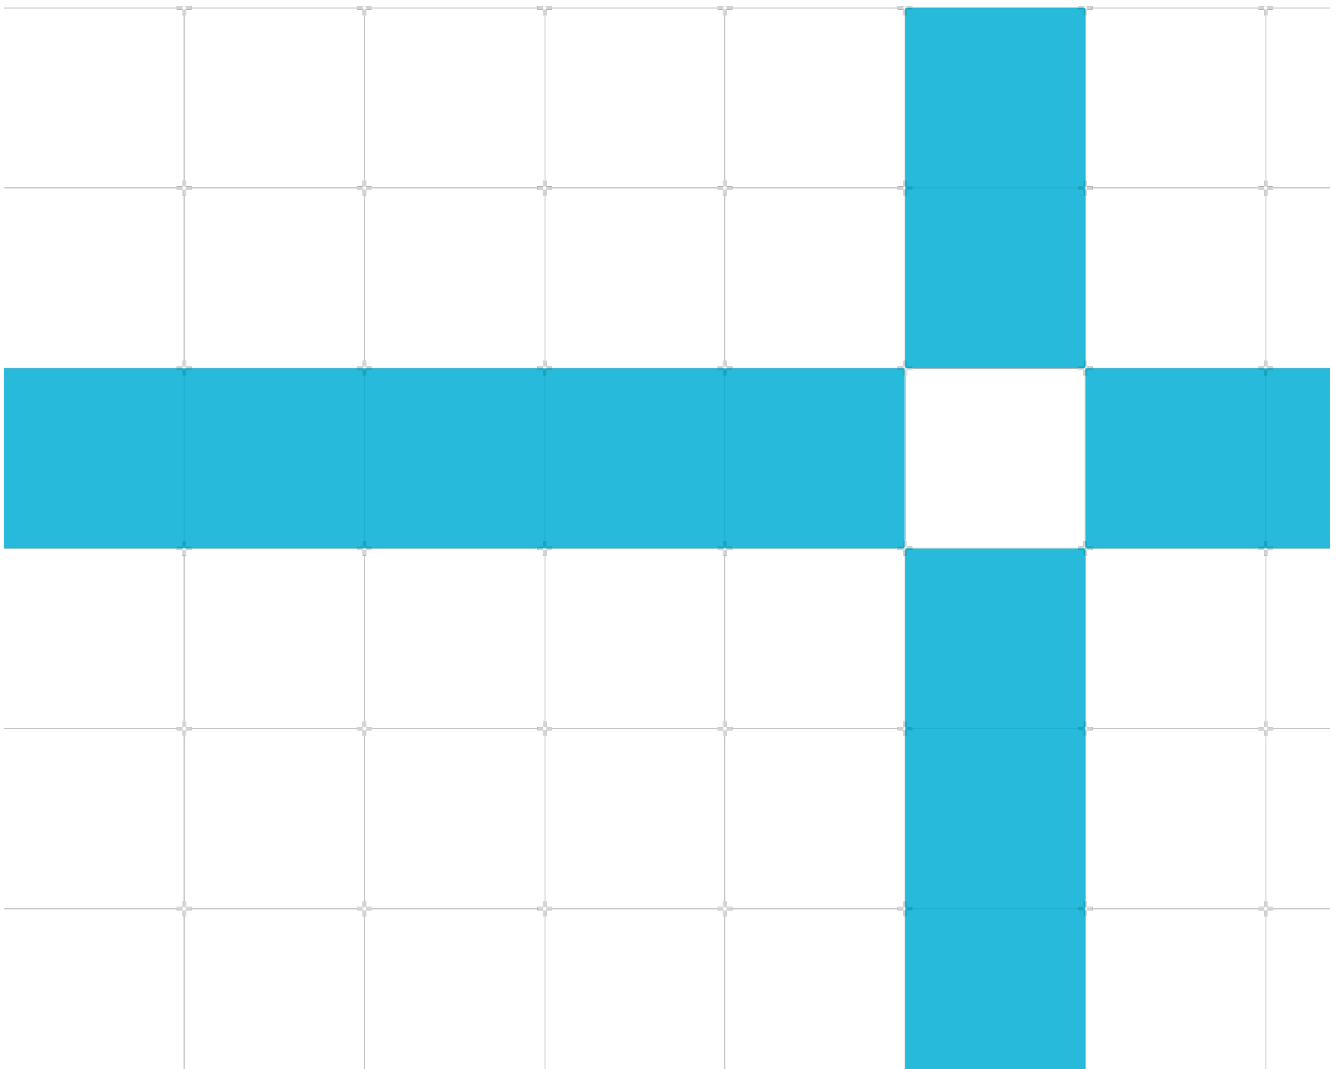

This document is Non-Confidential.

Copyright © 2023-2024 Arm® Limited (or its affiliates). All rights reserved.

This document is protected by copyright and other intellectual property rights.

Arm only permits use of this document if you have reviewed and accepted Arm's Proprietary notice found at the end of this document.

This document (SDEN_3050973_5.0_en) was issued on September 06, 2024.

There might be a later issue at <http://developer.arm.com/documentation/SDEN-3050973>

Inclusive language commitment

Arm values inclusive communities. Arm recognizes that we and our industry have used language that can be offensive. Arm strives to lead the industry and create change.

If you find offensive language in this document, please email terms@arm.com.

Feedback

Arm welcomes feedback on this product and its documentation. To provide feedback on Arm® Neoverse™ N3 (MP195), create a ticket on <https://support.developer.arm.com>.

To provide feedback on the document, fill the following survey:
<https://developer.arm.com/documentation-feedback-survey>.

Contents

rOp0 implementation fixes	5
Introduction	6
Scope	6
Categorization of errata	6
Change Control	7
Errata summary table	8
Errata descriptions	9
Category A	9
3114826 LDP instructions crossing a 64B boundary might return corrupted data	9
Category A (rare)	10
Category B	11
3711915 DSB ST instructions might not properly order younger loads	11
3699563 Read of ICH_VMCR_EL2.VBPR1 might return incorrect data based on SCR_EL3.NS	13
3645546 TBRE might write to memory for which it does not have write permissions	15
3456111 MSR PSTATE.SSBS to 0 is not fully self-synchronizing	16
3097813 Power off transition might deadlock if FULL_RET is enabled	17
Category B (rare)	17
Category C	18
3655258 ESR.IESB can have an incorrect value on SError	18
3655241 Injected Error can wrongly update Error Record Register	19
3655078 PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative	20
3637715 EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception	21
3522606 TRBIRQ is incorrectly masked when TRBLIMITR_EL1.E = 0	22
3127841 Checked stores in precise mode might fail to report tag check fails	23
3082770 Some PMU events might have incorrect values	25
3080100 SVE first faulting load crossing a 64B boundary might silently corrupt data in case of double external abort	26
Proprietary notice	27
Product and document information	29
Product status	29
Product completeness status	29

Product revision status

29

rOp0 implementation fixes

Note the following errata might be fixed in some implementations of rOp0. This can be determined by reading the REVIDR register where a value or a set bit indicates that the erratum is fixed in this part.

REVIDR[0] = 0x1	3114826	LDP instructions crossing a 64B boundary might return corrupted data
-----------------	---------	--

Note that there is no change to the MIDR_EL1 which remains at rOp0 but the REVIDR is updated to indicate which errata are corrected. Software will identify this release through the combination of MIDR_EL1 and REVIDR.

Introduction

Scope

This document describes errata categorized by level of severity. Each description includes:

- The current status of the erratum.
- Where the implementation deviates from the specification and the conditions required for erroneous behavior to occur.
- The implications of the erratum with respect to typical applications.
- The application and limitations of a workaround where possible.

Categorization of errata

Errata are split into three levels of severity and further qualified as common or rare:

Category A	A critical error. No workaround is available or workarounds are impactful. The error is likely to be common for many systems and applications.
Category A (Rare)	A critical error. No workaround is available or workarounds are impactful. The error is likely to be rare for most systems and applications. Rare is determined by analysis, verification and usage.
Category B	A significant error or a critical error with an acceptable workaround. The error is likely to be common for many systems and applications.
Category B (Rare)	A significant error or a critical error with an acceptable workaround. The error is likely to be rare for most systems and applications. Rare is determined by analysis, verification and usage.
Category C	A minor error.

Change Control

Errata are listed in this section if they are new to the document, or marked as "updated" if there has been any change to the erratum text. Fixed errata are not shown as updated unless the erratum text has changed. The [errata summary table](#) identifies errata that have been fixed in each product revision.

September 06, 2024: Changes in document version v5.0

ID	Status	Area	Category	Summary
3645546	New	Programmer	Category B	TBRE might write to memory for which it does not have write permissions
3699563	New	Programmer	Category B	Read of ICH_VMCR_EL2.VBPR1 might return incorrect data based on SCR_EL3.NS
3711915	New	Programmer	Category B	DSB ST instructions might not properly order younger loads
3637715	New	Programmer	Category C	EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception
3655078	New	Programmer	Category C	PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative
3655241	New	Programmer	Category C	Injected Error can wrongly update Error Record Register
3655258	New	Programmer	Category C	ESR.IESB can have an incorrect value on SError

April 30, 2024: Changes in document version v4.0

ID	Status	Area	Category	Summary
3456111	New	Programmer	Category B	MSR PSTATE.SSBS to 0 is not fully self-synchronizing
3522606	New	Programmer	Category C	TRBIRQ is incorrectly masked when TRBLIMITR_EL1.E = 0

February 21, 2024: Changes in document version v3.0

ID	Status	Area	Category	Summary
3080100	New	Programmer	Category C	SVE first faulting load crossing a 64B boundary might silently corrupt data in case of double external abort
3127841	New	Programmer	Category C	Checked stores in precise mode might fail to report tag check fails

November 16, 2023: Changes in document version v2.0

ID	Status	Area	Category	Summary
3114826	New	Programmer	Category A	LDP instructions crossing a 64B boundary might return corrupted data
3097813	New	Programmer	Category B	Power off transition might deadlock if FULL_RET is enabled
3082770	New	Programmer	Category C	Some PMU events might have incorrect values

September 29, 2023: Changes in document version v1.0

No errata in this document version.

Errata summary table

The errata associated with this product affect the product versions described in the following table.

ID	Area	Category	Summary	Found in versions	Fixed in version
3114826	Programmer	Category A	LDP instructions crossing a 64B boundary might return corrupted data	r0p0	Open
3711915	Programmer	Category B	DSB ST instructions might not properly order younger loads	r0p0	Open
3699563	Programmer	Category B	Read of ICH_VMCR_EL2.VBPR1 might return incorrect data based on SCR_EL3.NS	r0p0	Open
3645546	Programmer	Category B	TBRE might write to memory for which it does not have write permissions	r0p0	Open
3456111	Programmer	Category B	MSR PSTATE.SSBS to 0 is not fully self-synchronizing	r0p0	Open
3097813	Programmer	Category B	Power off transition might deadlock if FULL_RET is enabled	r0p0	Open
3655258	Programmer	Category C	ESR.IESB can have an incorrect value on SError	r0p0	Open
3655241	Programmer	Category C	Injected Error can wrongly update Error Record Register	r0p0	Open
3655078	Programmer	Category C	PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative	r0p0	Open
3637715	Programmer	Category C	EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception	r0p0	Open
3522606	Programmer	Category C	TRBIRQ is incorrectly masked when TRBLIMITR_EL1.E = 0	r0p0	Open
3127841	Programmer	Category C	Checked stores in precise mode might fail to report tag check fails	r0p0	Open
3082770	Programmer	Category C	Some PMU events might have incorrect values	r0p0	Open
3080100	Programmer	Category C	SVE first faulting load crossing a 64B boundary might silently corrupt data in case of double external abort	r0p0	Open

Errata descriptions

Category A

3114826

LDP instructions crossing a 64B boundary might return corrupted data

Status

Fault type: Programmer Category A.
Fault status: Present in r0p0. Open.

Description

LDP instructions crossing a 64B boundary might return corrupted data.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

- A load instruction R2 producing at least two destination registers, is executed in program order after a store instruction W1
- The memory access for R2 crosses a 64B boundary, but does not cross a 4KB boundary
- Virtual Address bits [29:12] for W1 are identical to Virtual Address bits [29:12] for R2
- Physical Address bits [39:12] for W1 are different from Physical Address bits [39:12] for R2
- Less than 32 store instructions are architecturally executed between W1 and R2
- Very specific micro-architectural timing conditions occur

Implications

If the previous conditions are met, the load instruction might return corrupted data in the second destination register.

Workaround

There is no workaround.

Category A (rare)

There are no errata in this category.

Category B

3711915

DSB ST instructions might not properly order younger loads

Status

Fault type: Programmer Category B
Fault status: Present in r0p0. Open.

Description

When executing a DSB ST instruction, load instructions following the DSB might not be properly ordered with respect to store instructions preceding the DSB.

Configurations affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

- A Write instruction W1 is executed.
- A DSB ST instruction is executed.
- A Read instruction R2 is executed.
- W1 and R2 access different memory locations.
- Some micro-architectural timing conditions occur.

Implications

If the previous conditions are met, R2 might be executed before W1. This only affects the result of R2 and the value of the memory location is not corrupted.

Workaround

This erratum can be avoided by inserting a DMB LD after each DSB ST using the following:

```
MOV x0, #5
MSR s3_6_c15_c8_0, x0
ISB
LDR x0, =0xd503329f
MSR s3_6_c15_c8_2, x0
LDR x0, =0xffffffff3ff
MSR s3_6_c15_c8_3, x0
```

```
MOV x1, #0
ORR x1, #1<<0
ORR x1, #3<<4
ORR x1, #0xf<<6
ORR x1, #1<<22
ORR x1, #1<<32
MSR s3_6_c15_c8_1, x1
ISB
```

3699563

Read of ICH_VMCR_EL2.VBPR1 might return incorrect data based on SCR_EL3.NS

Status

Fault type: Programmer Category B.
Fault status: Present in r0p0. Open.

Description

When ICH_VMCR_EL2.VBPR1 is written in Secure state (SCR_EL3.NS==0) and then subsequently read in Non-secure state (SCR_EL3.NS==1), a wrong value might be returned. The same issue exists in the opposite way: write in Non-secure state and read in Secure state. ICH_VMCR_EL2.VBPR1 is an alias of ICV_BPR1_EL1 which is architecturally defined as NOT banked. The RTL erroneously has this register implemented as two separate registers (secure and non-secure copies) banked by SCR_EL3.NS.

Configurations Affected

This erratum affects all configurations.

Conditions

The erratum occurs if all the following conditions apply:

1. The PE is executing at EL3
2. SCR_EL3.NS == 1 or 0
3. The PE executes an MSR ICH_VMCR_EL2.VBPR1 instruction
4. SCR_EL3.NS == 0 or 1 (the opposite value from when the MSR occurred)
5. The PE executes an MRS <dst>, ICH_VMCR_EL2.VBPR1 instruction

Implications

If the conditions are met, the MRS <dst>, ICH_VMCR_EL2.VBPR1 instruction will erroneously return the value that was last written to this field with the opposite SCR_EL.NS value from which it was read (or the reset value if it was never written in that security state).

Workaround

The workaround is for EL3 software that performs context save/restore on a change of Security state to use a value of SCR_EL3.NS when accessing ICH_VMCR_EL2 that reflects the Security state that owns the data being saved or restored. For example, EL3 software should set SCR_EL3.NS to 1 when saving or restoring the value ICH_VMCR_EL2 for Non-secure (or Realm) state. EL3 software should clear SCR_EL3.NS to 0 when saving or restoring the value ICH_VMCR_EL2 for Secure state.

3645546

TBRE might write to memory for which it does not have write permissions

Status

Fault type: Programmer Category B.
Fault status: Present in rOp0. Open.

Description

TBRE might write to memory for which it does not have write permissions.

Configurations affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

- TRBLIMITR_EL1.E = 1
- TBRE is stopped due to a stage 1 or stage 2 fault that occurred during the translation for TRBPTR_EL1
- An MSR instruction setting TRBLIMITR_EL1.E = 0 is executed
- An MSR clearing TRBSR_EL1.S is executed

Implications

If the previous conditions are met, TBRE might write to the memory at TRBPTR_EL1 despite the translation for TRBPTR_EL1 having caused a stage 1 fault or a stage 2 fault.

Workaround

For non-virtualized operating systems, no workaround is expected to be required since correctly-written software should place an ISB instruction following the MSR TRBLIMITR_EL1 that clears the E bit. For virtualized operating systems, this erratum can be avoided by ensuring the hypervisor does not expose the support for TBRE to the guest operation system. Arm expects this matches existing usages of TBRE under virtualization.

3456111

MSR PSTATE.SSBS to 0 is not fully self-synchronizing

Status

Fault type: Programmer Category B.
Fault status: Present in rOp0. Open.

Description

When PSTATE.SSBS is written to 0, the Arm Architecture specifies that side-effects are guaranteed to be visible to later instructions in the Execution stream. However, for a window of time during speculative execution of **MSR PSTATE.SSBS**, speculative store data bypassing might still occur.

Configurations affected

This erratum affects all configurations.

Conditions

The erratum occurs if the following condition applies:

MSR PSTATE.SSBS executes, setting PSTATE.SSBS to 0.

Implications

Security sensitive code executed shortly after **MSR PSTATE.SSBS** to 0 might not be fully protected by the *Speculative Store Bypass Safe* (SSBS) feature.

Workaround

Software at EL3, EL2, and EL1 should follow writes to the SSBS register with a *Speculation Barrier* (SB) instruction to ensure that the new value of PSTATE.SSBS affects subsequent instructions in the Execution stream under speculation.

A kernel at EL1 or EL2 should not advertise the presence of MRS/MSR instructions to read/write the SSBS register from ELO. Arm expects that kernels provide system calls for ELO software to modify PSTATE.SSBS when the SSBS register is not implemented and that ELO software will use this when the presence of the SSBS register is not advertised.

3097813

Power off transition might deadlock if FULL_RET is enabled

Status

Fault type: Programmer Category B.
Fault status: Present in rOp0. Open.

Description

If the interrupt/event retention bits are non-zero in the IMP_CPUPWRCTLR_EL1 register to enable the FULL_RET power mode, then the power transition from ON to OFF/OFF_EMU might deadlock.

Configurations Affected

All configurations are affected.

Conditions

This erratum occurs under the following conditions:

1. The IMP_CPUPWRCTLR_EL1.WFI_RET_CTLR or IMP_CPUPWRCTLR_EL1.WFE_RET_CTLR fields are non-zero, enabling the FULL_RET power mode.
2. Software sets the IMP_CPUPWRCTLR_EL1.CORE_PWRDN_EN bit to request a powerdown.
3. The core executes a WFI or WFE instruction.
4. The PPU starts a power transition to OFF or OFF_EMU.

Implications

If the erratum conditions occur, then the power transition to OFF or OFF_EMU might deadlock.

Workaround

For workaround, as part of the power down sequence, EL3 software should set the IMP_CPUPWRCTLR_EL1.WFI_RET_CTLR and IMP_CPUPWRCTLR_EL1.WFE_RET_CTLR fields to zero before it sets the IMP_CPUPWRCTLR_EL1.CORE_PWRDN_EN field.

Category B (rare)

There are no errata in this category.

Category C

3655258

ESR.IESB can have an incorrect value on SError

Status

Fault type: Programmer Category C.
Fault status: Present in rOp0. Open.

Description

ESR.IESB is supposed to be set only when getting an SError during the IESB phase of an exception entry or exit, and if SError exception is taken after this exception entry/exit. Instead, it can be incorrectly set to 1 or 0.

Configurations affected

This erratum affects all configurations.

Conditions

The erratum occurs if all the following conditions apply, and ESR.IESB for the SError exception might incorrectly be set to 1:

- SCTLR_ELx.IESB is set for any ELx, or SCR_EL3.EA & SCR_EL3.NMEA is set
- An SError arrives

The erratum also occurs if all the following conditions apply, and ESR.IESB for the SError exception, which is taken after exception entry, will incorrectly be set to 0:

- An exception entry other than SVC/HVC/SMC is taken, targeting EL1 or EL2
- SCTLR_ELx.IESB is set, where x is the target EL
- An SError arrives during exception entry

Implications

ESR.IESB on SError exceptions is not correct.

Workaround

There is no workaround.

3655241

Injected Error can wrongly update Error Record Register

Status

Fault type: Programmer Category C.
Fault status: Present in rOp0. Open.

Description

Injected Error can wrongly update Error Record Register (ERX/ERRMISCO).

Configuration affected

This erratum affects all configurations.

Conditions

The erratum occurs if all the following sequence of conditions apply:

1. Pseudo-fault Generation Feature is enabled and an error is injected
2. Error results in a corrected error increment

Implications

If the previous conditions are met, the CECO/CECR/OFR/OFO fields of AArch64-ERXMISCO_EL1 and ext-ERRMISCO registers can be updated without setting to 1 the MV field of Error Record Primary Status Register.

Workaround

No workaround is expected to be required.

3655078

PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative

Status

Fault type: Programmer Category C.
Fault status: Present in r0p0. Open.

Description

When software directly writes PSTATE.PAN or PSTATE.UAO with an MSR instruction, the Arm Architecture specifies that side-effects are guaranteed to be visible to later instructions in the Execution stream. However, for a window of time prior to the execution of MSR PSTATE.{PAN,UAO}, instructions following the MSR might speculatively execute with the old context, prior to re-executing non-speculatively under the new, expected context.

Configurations affected

This erratum affects all configurations.

Conditions

The erratum occurs if the following condition applies:

- MSR PSTATE.{PAN or UAO} executes

Implications

Speculative execution of instructions using stale PSTATE.{UAO,PAN} context could in theory present a window of opportunity for a security attack. However, Arm security team has evaluated the practical risk to be very low, given the use-cases of the bits in question and the complexity involved in exploiting.

Workaround

A workaround is not expected to be required.

3637715

EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception

Status

Fault type: Programmer Category C.
Fault status: Present in r0p0. Open.

Description

When a Load-Exclusive instruction is executed with Halting Step enabled, EDSCR.STATUS is not updated if the Load-Exclusive instruction causes a synchronous exception.

Configurations affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. In Debug state, the debugger enables Halting Step
2. Debug state is exited and a Load-Exclusive instruction (LDX*/LDAX*) is stepped
3. The Load-Exclusive generates a synchronous exception while executing

Implications

If the conditions are met, EDSCR.STATUS will not be updated.

Workaround

There is no workaround.

3522606

TRBIRQ is incorrectly masked when TRBLIMITR_EL1.E = 0

Status

Fault type: Programmer Category C.
Fault status: Present in rOp0. Open.

Description

TRBIRQ is incorrectly masked when TRBLIMITR_EL1.E = 0.

Configurations affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

- TRBSR_EL1.IRQ = 1
- TRBLIMITR_EL1.E = 0

Implications

If the previous conditions are met, the trace buffer management interrupt, TRBIRQ, will not be asserted.

Workaround

Arm does not believe a workaround is needed for this erratum.

3127841

Checked stores in precise mode might fail to report tag check fails

Status

Fault Type: Programmer Category C.
Fault Status: Present in r0p0. Open.

Description

When *Memory Tagging Extension* (MTE) is used in Synchronous mode, the Tag-Check-read performed by a load or store instruction might fail to be ordered with respect to older instructions with acquire semantics. This ordering violation might lead to the store instruction writing to memory in cases where it should have failed its tag check.

Configurations affected

This erratum affects configurations with `BROADCASTMTE = 1`.

Conditions

The erratum occurs under the following conditions:

- MTE is enabled in precise checking mode (`SCTLR_ELx.TCF = 0b01`).
- An instruction R1 with acquire semantics is executed. R1 can be one of:
 - Any LDAR* or LDAP* instruction.
 - Any SWP*, CAS*, or LD* Atomic instruction with acquire semantics.
- A tag-checked load or store instruction W3, performing a Tag-Check-read R2, is executed.
- R1 is in program order before W3.

Implications

When the previous conditions are met, the Tag-Check-read R2 performed by W3 might be observed before R1.

- If the observed tag value does not cause a Tag Check Fault, W3 will update memory even in cases where observation in the correct order should have resulted in a tag Check Fault.
- If the observed tag value causes a Tag Check Fault, there are no implications and the *Processing Element* (PE) behaves as expected.

This will lead to a very small percentage of escapes in the tag checking logic, sometimes causing a tag check pass when it should be a tag check fail.

Workaround

There is no workaround.

3082770

Some PMU events might have incorrect values

Status

Fault type: Programmer Category C.
Fault status: Present in rOp0. Open.

Description

Some *Performance Monitoring Unit* (PMU) events might be counted incorrectly and either be incremented in situations where they should not, or fail to be incremented in situations where they should.

Configurations affected

This erratum affects all configurations.

Conditions

The erratum occurs if a given PMU counter is configured to count the following event, resulting in events that might be significantly miscounted:

- 0x0027, L2I_CACHE

Implications

If the previous condition is met, the affected PMU event will be incorrect.

Workaround

The correct value of L2I_CACHE can be obtained from using event 0x0001 L1I_CACHE_REFILL.

3080100

SVE first faulting load crossing a 64B boundary might silently corrupt data in case of double external abort

Status

Fault Type: Programmer Category C.
Fault Status: Present in r0p0. Open.

Description

SVE first faulting load crossing a 64B boundary might silently corrupt data in case of double external abort.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

- A load instruction is executed
- A load instruction R1 loads at least 32 bytes of data to SIMD&FP registers or SVE registers
- The access is mapped to cacheable memory
- The access crosses a 64 bytes boundary
- An external abort response is sent by the system for both 64B regions
- Very specific micro-architectural timing conditions occur

Implications

If the previous conditions are met, the load instruction might behave as follows:

- the First Fault Register is updated to the first active element after the 64B boundary
- data for all active elements will be set to 0

Workaround

There is no workaround.

Proprietary notice

This document is protected by copyright and other related rights and the use or implementation of the information contained in this document may be protected by one or more patents or pending patent applications. No part of this document may be reproduced in any form by any means without the express prior written permission of Arm Limited ("Arm"). No license, express or implied, by estoppel or otherwise to any intellectual property rights is granted by this document unless specifically stated.

Your access to the information in this document is conditional upon your acceptance that you will not use or permit others to use the information for the purposes of determining whether the subject matter of this document infringes any third party patents.

The content of this document is informational only. Any solutions presented herein are subject to changing conditions, information, scope, and data. This document was produced using reasonable efforts based on information available as of the date of issue of this document. The scope of information in this document may exceed that which Arm is required to provide, and such additional information is merely intended to further assist the recipient and does not represent Arm's view of the scope of its obligations. You acknowledge and agree that you possess the necessary expertise in system security and functional safety and that you shall be solely responsible for compliance with all legal, regulatory, safety and security related requirements concerning your products, notwithstanding any information or support that may be provided by Arm herein. In addition, you are responsible for any applications which are used in conjunction with any Arm technology described in this document, and to minimize risks, adequate design and operating safeguards should be provided for by you.

This document may include technical inaccuracies or typographical errors. THIS DOCUMENT IS PROVIDED "AS IS". ARM PROVIDES NO REPRESENTATIONS AND NO WARRANTIES, EXPRESS, IMPLIED OR STATUTORY, INCLUDING, WITHOUT LIMITATION, THE IMPLIED WARRANTIES OF MERCHANTABILITY, SATISFACTORY QUALITY, NON-INFRINGEMENT OR FITNESS FOR A PARTICULAR PURPOSE WITH RESPECT TO THE DOCUMENT. For the avoidance of doubt, Arm makes no representation with respect to, and has undertaken no analysis to identify or understand the scope and content of, any patents, copyrights, trade secrets, trademarks, or other rights.

TO THE EXTENT NOT PROHIBITED BY LAW, IN NO EVENT WILL ARM BE LIABLE FOR ANY DAMAGES, INCLUDING WITHOUT LIMITATION ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, PUNITIVE, OR CONSEQUENTIAL DAMAGES, HOWEVER CAUSED AND REGARDLESS OF THE THEORY OF LIABILITY, ARISING OUT OF ANY USE OF THIS DOCUMENT, EVEN IF ARM HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

Reference by Arm to any third party's products or services within this document is not an express or implied approval or endorsement of the use thereof.

This document consists solely of commercial items. You shall be responsible for ensuring that any permitted use, duplication or disclosure of this document complies fully with any relevant export laws and regulations to assure that this document or any portion thereof is not exported, directly or indirectly, in violation of such export laws. Use of the word "partner" in reference to Arm's customers is not intended to create or refer to any partnership relationship with any other company. Arm may make changes to this document at any time and without notice.

This document may be translated into other languages for convenience, and you agree that if there is any conflict between the English version of this document and any translation, the terms of the English version of this document shall prevail.

The validity, construction and performance of this notice shall be governed by English Law.

The Arm corporate logo and words marked with ® or ™ are registered trademarks or trademarks of Arm Limited (or its affiliates) in the US and/or elsewhere. Please follow Arm's trademark usage guidelines at <https://www.arm.com/company/policies/trademarks>. All rights reserved. Other brands and names mentioned in this document may be the trademarks of their respective owners.

Arm Limited. Company 02557590 registered in England.

110 Fulbourn Road, Cambridge, England CB1 9NJ.

(PRE-1121-V1.0)

Product and document information

Read the information in these sections to understand the release status of the product and documentation, and the conventions used in the Arm documents.

Product status

All products and Services provided by Arm require deliverables to be prepared and made available at different levels of completeness. The information in this document indicates the appropriate level of completeness for the associated deliverables.

Product completeness status

The information in this document is Final, that is for a developed product.

Product revision status

The rxpy identifier indicates the revision status of the product described in this manual, where:

rx

Identifies the major revision of the product.

py

Identifies the minor revision or modification status of the product.